INTEROFFICE MEMO



Famous for holding an edge!

(714) 449-1100

P.O. BOX 1267 • EL CAJON, CA 92022

DATE:

January 20, 1987

TO:

All Concerned

FROM:

Theodore R. Tarleton, Jr., Quality Assurance Manager

SUBJECT:

Nonconforming Material Report

The following is a list of discrepancies found by DCAS and Phrobis III on the initial production run of MPBS:

A. Blade:

- 1. Unauthorized "chevron" mark on blade (reference NMR #0002)
- 2. Uneven hollow grind
 - a. Edge thickness
 - b. Hollow grind height left vs. right
- 3. Dip in hollow grind near tip of blade.
- 4. Sharpness
 - a. Flat spots
 - b. Rolled edges
- 5. Broaching tear back bone of blade

NOTE: DCAS used Phrobis III drawing for comparision of final product.

EXAMPLE: Saw teeth were counted!

- B. Black oxide parts Cutter Plate, Quillon, and Latch Plate. . . Future shipments must be corrected for the following. . .
 - 1. Improper cleaning before black oxidizing
 - 2. Black oxide finish no raw material visible
 - 3. Radius all edges
 - a. No sharp corners
 - b. Burr free

C. Handle

- 1. Finish even
- 2. No heavy parting lines
- 3. Latch Plate slot parallel